



TEREX TELELECT

Product Advisory

PA-1005-01

DATED: 12/12/01

REVISED:

MODEL(S): XT Series, XT Series Transverse Lift, 5FC Transverse Lift, and TLM Transverse Lift.

SUBJECT: Inspection and lubrication of pivot points.

ATTN: Equipment owners and users:

Terex Telelect has received a report of a missing retainer bolt that attaches the upper boom cylinder (Rod end) to the tri-link on the XT series. The pin fell out during road travel and was discovered before use. This could have been prevented if proper inspection and maintenance had been routinely performed.

On June 27th, 2001, Terex Telelect released Product Advisory #PA-1004-01. This product advisory offered a field service kit (P/N 000Z815) to aid in the lubrication of the lower boom cylinder pivot pin. This kit also provides a new retainer bolt, spacer, and nut for this area in the event that the bolt fails, due to lack of lubrication. Effective November 16, 2001, two additional bolts, spacers, and nuts have been added to this kit to be utilized in the upper boom cylinders - to tri-link pin retainer.

In addition, Terex Telelect would like to offer the new retainer bolts for the transverse lift product line. A field service kit P/N 000Z821, in addition to the P/N 000Z815, is being offered at no charge. The parts required to perform this update will be sent to the latest registered owner, or to the selling dealer in the event a unit registration card has not been filed. It will be the selling dealer's responsibility to forward these kits to the owners of the non-registered units. To find your local dealer please visit www.telelect.com. Labor to install the kits will be the owner's responsibility.

Should you have any questions or comments concerning this bulletin, please contact

600 Oakwood Road ▪ Watertown, SD 57201 USA ▪ (605) 882-4000 ▪ Fax (605) 882-1842
simple, available, and cost effective™