


AC DIELECTRIC TESTING OF A CATECORY B TELESCOPIC AERIAL DEVICES

NO. 110

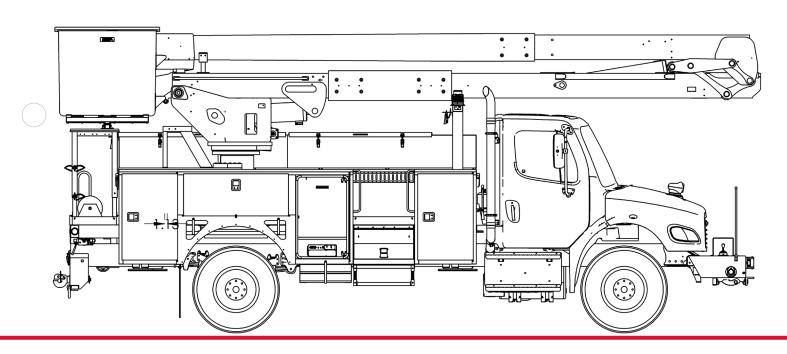



SERVICE CALL:

AC DIELECTRIC TESTING OF A CATEGORY B TELESCOPIC AERIAL DEVICE



MODEL(S):

TL



TOOLS NEEDED:

AC DIELECTRIC TESTER
INSULATING OUTRIGGER PADS
MULTIMETER CAPABLE OF
MEASURING RESISTANCE (OHMS)
SAFETY EQUIPMENT TO CREATE
A DIELECTRC TEST AREA

PHONE: 1-844-TEREX4U (1-844-837-3948) | EMAIL: <u>UTILITIES.SERVICE@TEREX.COM</u>



DANGER

Failure to obey the instructions and safety rules in the appropriate Operator's Manual and Service Manual for your machine will result in death or serious injury.

Many of the hazards identified in the Operator's Manual are also safety hazards when maintenance and repair procedures are performed.

DO NOT PERFORM MAINTENANCE UNLESS:

- √ You are trained and qualified to perform maintenance on this machine.
- √ You read, understand and obey:
 - manufacturer's instructions and safety rules
 - employer's safety rules and worksite regulations
 - · applicable governmental regulations
- √ You have the appropriate tools, lifting equipment and a suitable workshop.

The information contained in this Tech Tip is a supplement to the Service Manual. Consult the appropriate Service Manual of your machine for safety rules and hazards.



TECH TIP 110 | RELEASED 05.15.2024 | VERSION 1.1 ©TEREX UTILITIES. ALL RIGHTS RESERVED



CONTENTS

TECH TIP#110



| Set-up

STEP 1 - STEP 3



| Inspect and test the lower test electrode system

STEP 4



| Install jumpers

STEP 5 - STEP 6



Attach the current meter

STEP 7





Install the test shield

STEP 8

| Position the booms at 45 degrees

STEP 9

12

| Plug in and turn on the dielectric tester

STEP 10

13

| Testing the lower boom

STEP 10 - STEP 14

| Testing upper control handle

16

| Testing upper control handle

STEP 17 - STEP 20

17/

STEP 21 - STEP 24

In the interest of safety, the dielectric testing area should be separated from the normal work area by means of a barrier to keep anyone unassociated with the procedure out of the testing area. If a barrier is not available, use a spotter(s). The AC Dielectric Tester voltage source should also be contained within this area.

The test area must be free of any obstructions both on the ground and above/around the unit. The boom must not be near any trees, buildings or energized power lines when elevated for testing.

STEP 2

Consult the ID Placard to determine whether the unit is insulated or non-insulated. If the unit is insulated, the qualification voltage and rating of the unit will be shown. **Figure 1 and 2**

Units which have been tested and rerated at higher than 69KV will have a rerate tag alongside the ID plate showing the new rating.



Verify that the boom is designed as insulated before proceeding with the dielectric test.

STEP 3

Complete a thorough daily inspection of the unit, including running all boom functions through their full range of motion before beginning any dielectric testing. Daily inspection criteria can be found in the unit specific operators and maintenance manuals.

The fiberglass booms must be clean, dry and in good physical condition. Check carefully for any bird's nests, material buildup, or hydraulic leaks in the boom or control areas. Check under the boom tip covers and look down each boom from both ends checking for a blockage or any signs of a leak. A bird's nest, blockage, or leak in the boom could ignite and cause a fire during the dielectric test.

If a blockage or leak is found it must be repaired and the unit cleaned prior to continuing with the dielectric test.

Record all unit info and weather conditions on the dielectric test sheet prior to starting the test. The test sheets are included in the unit specific manual and can be copied as needed.

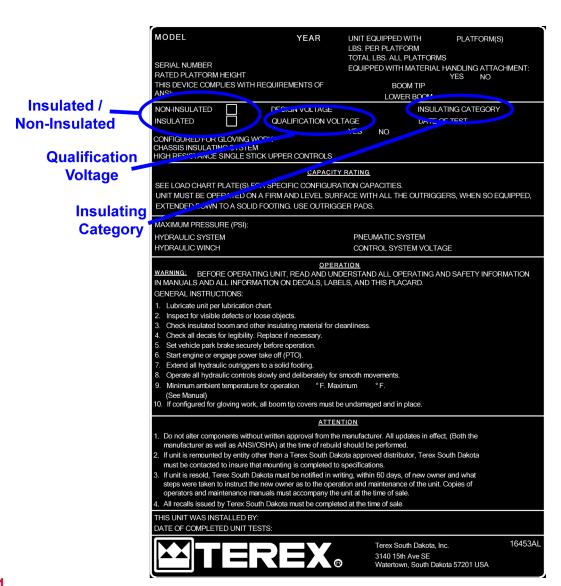


FIGURE 1

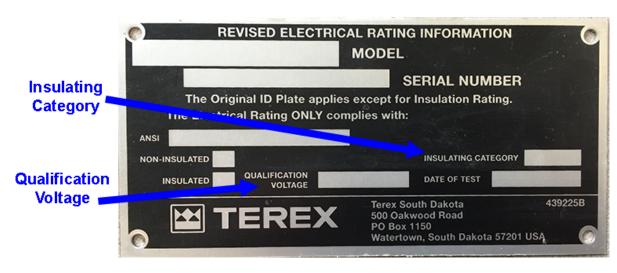


FIGURE 2

PAGE 5 OF 18


Inspect and test the Lower Test Electrode System.

This is done by checking for "Electrical Continuity" between the center core of the Amphenol connector on the boom and the locations listed below. There should be less than 100 OHMS of resistance shown on the meter. It will typically be less than 5 OHMS.

- **Outer Test Band**
- Inner Test Band
- Hose Assembly Bulkhead



Testing for "Electrical Insulation" between the center core of the Amphenol connector on the boom and steel elbow will also need to be completed. There should be more than 10,000 OHMS of resistance shown on the meter. It will typically be over 1 MOHM.

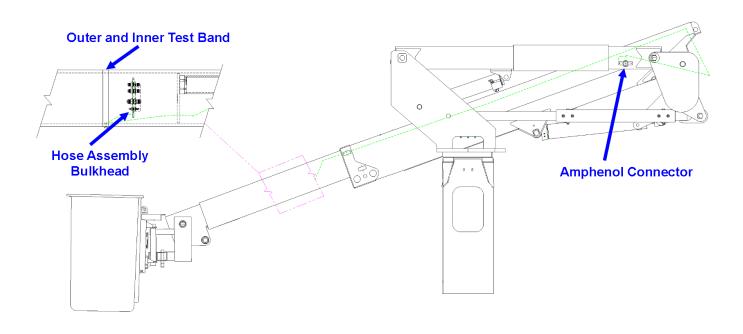

Drive the unit into the dielectric testing area and onto the insulating platforms (pads) centered under the tires. Engage the park brake, place the transmission in neutral and turn on the PTO.

Set the unit up for operation by deploying the outriggers onto insulating platforms (pads) centered under the outrigger foot, reference Figure 5. Once outrigger setup is complete, shift the outrigger/unit selector into the unit position. The boom can be brought to the ground mount position to aid in set-up during the next steps.

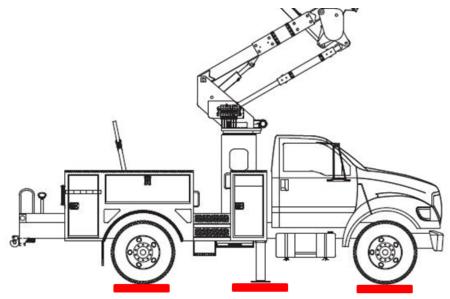


FIGURE 5

STEP 6


To begin setup for testing the upper boom, install jumpers between components in the following locations as shown in Figure 6:

- Turntable above rotation to pedestal below rotation (#1)
- Turntable above rotation to lower boom (#2)
- Lower boom insert (#3)
- Knuckle to Lower Boom (#4)
- Platform bracket to boom tip bracket (#5)
- Jib bracket (if equipped) to platform bracket (#7)
- Truck chassis to earth ground (#8)

Verify that the jumpers make good contact by removing paint, if needed, at the attachment location prior to attaching the jumpers. Some units are equipped with stainless bolts specifically for dielectric testing, use these if equipped. For the truck chassis to earth ground use the ground lug or loop if available at the rear of the truck.

STEP 6 (Continued)

The jumpers and connections are shown in RED in the following Figures. They do not reflect the actual connection points where the jumpers are installed on the unit but are only a reference to the general location.

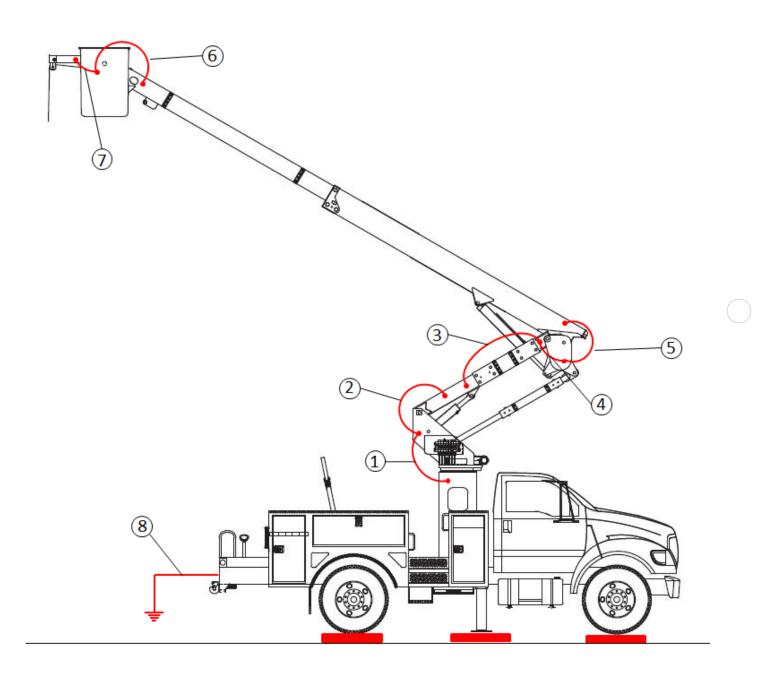

Attach the current meter return to the Amphenol connector shown in Step 4. The connector is located on the lower boom just forward of the lower boom insert.

Attach the voltage source from the AC Dielectric Tester to the boom tip. This may be attached at the same location as the jumpers that were installed at the boom tip. See **Figure 8**. Keep the test machine directly below or away from the truck if possible.


Follow the instructions of the dielectric testing machine for any further connections that are required. Verify that the dielectric tester has been grounded.



The dielectric tester controls should be located outside the dielectric test area.


Install the test shield according to the instructions on kit sheet 495464.

Note: Refer to the unit parts manual to determine if the tested unit requires a shield over the test bands.

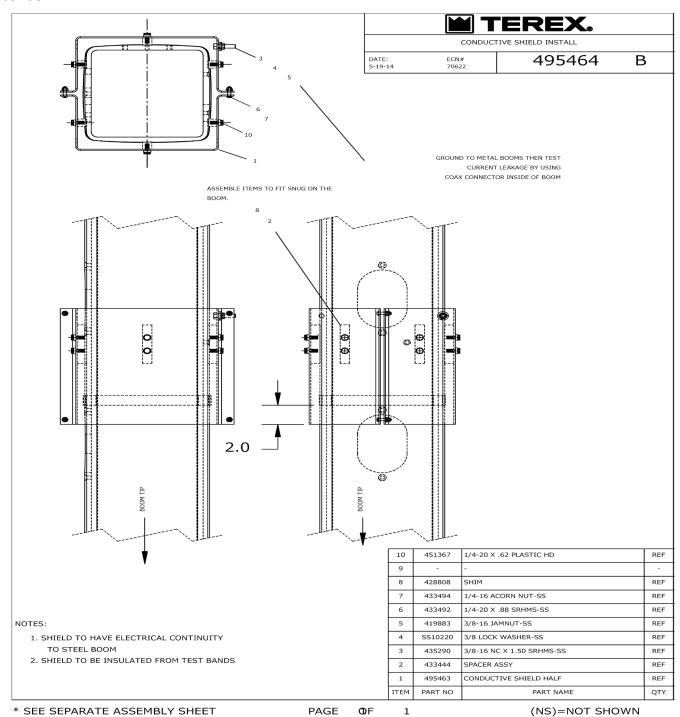

Position the lower and upper booms both at 45 degrees. Extend the upper boom to the minimum extension decal (if equipped).

Visually check that all jumpers, voltage source from the AC Dielectric Tester, and return are still connected once unit is in position.

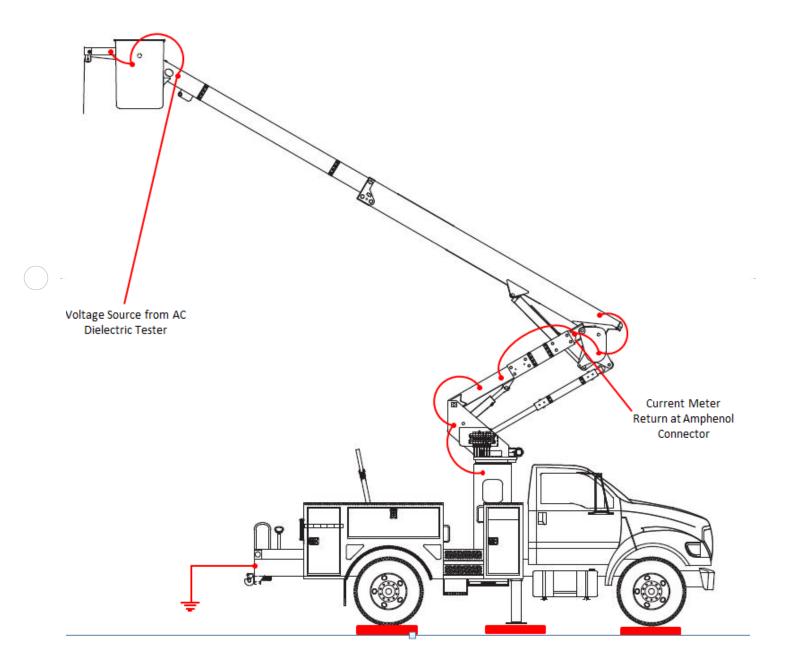

Plug in and turn on the dielectric tester. Raise the voltage control to the required voltage listed on the test sheet. Monitor the volt and current meters to verify the test is working correctly. If the current meter reads zero, verify all connections.

If the current meter value stays below the Max Leakage, continue the test until complete, record readings, return the voltage control to 0, turn off and unplug the dielectric machine.

If the current meter value exceeds the Max Leakage at any point during the test, return the voltage control to 0, turn off and unplug the dielectric machine. Begin troubleshooting to determine why the boom will not pass the dielectric test. Reference Tech Tip #51 for further troubleshooting help.

The upper boom Qualification and Periodic readings are shown below. Qualification testing is done on a new unit install or after a major component such as a boom is replaced. Periodic testing is done once a year to verify dielectric integrity of the unit.

For a 69kv Category B AC Qualification test, the reading for Rated Voltage should be no higher than 40 μ A for 1 minutes at 40 kV and Double Rated should be no higher than 80 μ A for 1 minutes at 80 kV.

			4 MINUTE AC	TECT VOLTAC	-
		1 MINUTE AC TEST VOLTAGE			
UNIT QUALIFICATION	TEST TIME	Rat	ted	Double	e Rated
VOLTAGE AC	AM PM		40 kv		80 kv
69kv	Start		μА		μА
	Finish		μА		μА
S/N_	Max Leakage		40 µA		80 μΑ

The 10 second Momentary Withstand Voltage Test should be no higher than 120 μ A for 10 Seconds at 120 kV.

		10 Sec. Momentary Withstand Voltage Test		
UNIT QUALIFICATION		(No Flashover Allowed)		
VOLTAGE AC			120 kv	
69kv			μА	
			μА	
S/N			120 µA	

µA=Microamp

STEP 10 (Continued)

For a 69kV Category B AC Periodic/Maintenance Test the reading should be no higher than 60 μ A for 1 minute at 60 kV.

Unit Qualification	AC TEST - 1 Minute		
Voltage	TEST VOLTAGE	Time	Leakage
	60KV	Start	μA
69KV		Finish	μA
		Max. Leakage	60 µA

STEP 11

Once testing is complete bring the upper and lower booms down to access the jumpers, voltage source and Current Meter Return at the Amphenol connector. Disconnect the voltage source and Current Meter Return at the Amphenol connector from the boom.

STEP 12 - See Figure 6 to identify jumpers.

- Remove the following jumpers:
- Turntable above rotation to pedestal below rotation (#1)
- Lower boom insert (#3)
- Knuckle to lower boom (#4)
- Upper boom to knuckle (#5)
- Platform bracket to boom tip bracket (#6)
- Jib bracket (if equipped) to platform bracket (#7)

STEP 13

To begin setup for testing the lower boom, raise the upper boom up to a 45-degree angle. Raise the lower boom high enough to clear all obstacles and rotate the turntable 180 degrees so that the knuckle is off the back of the unit as shown in **Figure 12**.

STEP 14


Attach the Current Meter Return to the back of the truck as shown in **Figure 12**. If a ground lug or loop is available, attach the return there.

Attach the voltage source from the AC Dielectric Tester to the knuckle side of the lower boom and install jumpers between components in the following locations as shown in Figure 4:

- Lower boom to knuckle (#1)
- Lower boom link to knuckle (#2)
- Turntable above rotation to pedestal below rotation (#3)
- Lower boom link to turntable (#4)

Raise the lower boom to at least a 45 degree angle.

Visually check that all jumpers, voltage source from the dielectric tester and the return are still connected once the unit is in position.

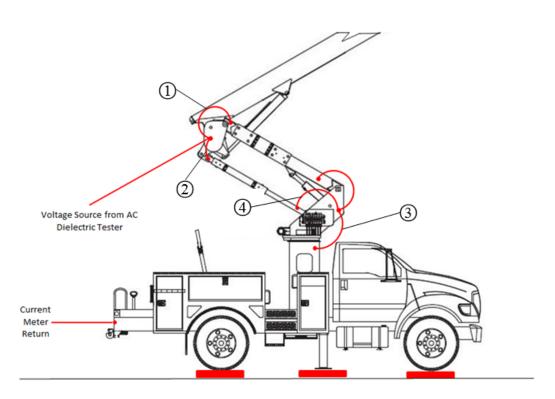

Plug in and turn on the dielectric tester. Raise the voltage control to the required voltage listed on the test sheet. Monitor the volt and current meters to verify that the test is working correctly.

If the current meter value stays below the Max Leakage continue test until complete, record readings, return the voltage control to 0, turn off and unplug the dielectric machine.

If the current meter value exceeds the Max Leakage at any point during the test return the voltage control to 0, turn off and unplug the dielectric machine. Begin troubleshooting to determine why the boom will not pass the dielectric test. Reference Tech Tip #51 for further troubleshooting help.

The lower boom Qualification and Periodic readings are shown below.

For a Chassis Insulating System (Lower Boom Insert) Qualification test, the reading should be no higher than 3000 μA for 3 minutes at 50 kV.

	TEST TIME	3 MINUTE AC	TEST VOLTAGE
	AM PM	50 kv	
	Start		μА
	Finish		μА
S/N	Max Leakage		3000 μΑ

For a Chassis Insulating System (Lower Boom Insert) Periodic/Maintenance test the reading should be no higher than 3000 µA for 1 minute at 35 kV.

AC TEST - 1 Minute			
TEST VOLTAGE	Time	Leakage	
	Start	μA	
35 KV	Finish	μΑ	
	Max. Leakage	3000 μΑ	

µA=Microamp

Once testing is complete disconnect the voltage source from the boom.

Remove all the jumpers from the following locations indicated in Figure 12:

- Lower boom to knuckle (#1)
- Lower boom link to knuckle (#2)
- Turntable above rotation to pedestal below rotation (#3)
- Lower boom link to turntable (#4)

Remove the return from the back of the truck.

STEP 18

To begin setup for testing the upper control handle, bring the platform to the ground mount position at the back of the truck.

STEP 19

Attach the voltage source from the AC Dielectric Tester to the control handle using a spring with the cable going over the top of the platform as shown below.

STEP 20

Reach under the upper control cover and attach the current meter return to a fitting that is attached to the upper control valve as shown below. (Cover removed for clarity)





Elevate the platform to at least 4 feet above the ground. Visually check that all jumpers, the voltage source from the dielectric tester, and the return are still connected once the unit is in position.

STEP 22

Plug in and turn on the dielectric tester. Raise the voltage control to the required voltage listed on the test sheet. Monitor the volt and current meters to verify that the test is working correctly.

If the current meter value stays below the Max Leakage continue the test until it is complete, record readings, return the voltage control to 0, turn off and unplug the dielectric machine.

If the current meter value exceeds the Max Leakage at any point during the test, return the voltage control to 0, turn off and unplug the dielectric machine. Begin troubleshooting to determine why the single stick control handle will not pass the dielectric test.

The Single Stick Qualification and Periodic readings are shown below.

For a Single Stick Control AC Qualification and Periodic/ Maintenance test the reading should be no higher than 400 µA for 3 minutes at 40 kV.

Test time: AM / PM 3 minutes		AC test (40KVAC)	Leakage
Start			μA
Finish			μΑ
		Allowable	400 µA

µA=Microamp

STEP 23

Once testing is complete lower the platform to the ground mount position. Remove the spring from the control handle and current meter return from the upper control valve fitting.

STEP 24

Store the unit and raise the outriggers. Remove any barriers around the unit and drive the unit off the pads and out of the dielectric test area.



FOR FURTHER ASSISTANCE,
CONTACT THE TEREX UTILITIES TECHNICAL SUPPORT TEAM

PHONE: 1-844-TEREX4U (1-844-837-3948) | EMAIL: <u>UTILITIES.SERVICE@TEREX.COM</u>